# Material Safety Data Sheet



VISX Laser Mix: Argon / Fluorine / Helium / Neon

### Section 1. Chemical product and company identification

Product name : VISX Laser Mix: Argon / Fluorine / Helium / Neon

Supplier : AIRGAS INC., on behalf of its subsidiaries

259 North Radnor-Chester Road

Suite 100

Radnor, PA 19087-5283

1-610-687-5253

Product use : Synthetic/Analytical chemistry. Lasers.

Synonym : "VISX Laser Mix"

MSDS # : 002372 Date of : 8/28/2009.

**Preparation/Revision** 

<u>In case of emergency</u> : 1-866-734-3438

#### Section 2. Hazards identification

Physical state : Gas.

**Emergency overview** : WARNING!

CONTENTS UNDER PRESSURE.

Do not puncture or incinerate container.

Contact with rapidly expanding gases can cause frostbite.

Routes of entry : Inhalation

Potential acute health effects

Eyes : Corrosive to eyes.

Skin : Corrosive to the skin.

**Inhalation** : Acts as a simple asphyxiant.

**Ingestion**: Ingestion is not a normal route of exposure for gases

Potential chronic health

effects

enecis

: CARCINOGENIC EFFECTS: Not available.

MUTAGENIC EFFECTS: Not available.

TERATOGENIC EFFECTS: Not available.

Medical conditions aggravated by overexposure : Acute or chronic respiratory conditions may be aggravated by overexposure to this gas.

See toxicological information (section 11)

## Section 3. Composition, Information on Ingredients

<u>Name</u>	CAS number	<u>% Volume</u>	Exposure limits
Helium	7440-59-7	1 - 99	Oxygen Depletion [Asphyxiant]
Argon	7440-37-1	1 - 99	Oxygen Depletion [Asphyxiant]
Neon	7440-01-9	1 - 99	Oxygen Depletion [Asphyxiant]
Fluorine	7782-41-4	0.00001 - 0.519	ACGIH TLV (United States, 1/2009).

STEL: 3.1 mg/m³ 15 minute(s). STEL: 2 ppm 15 minute(s). TWA: 1.6 mg/m³ 8 hour(s). TWA: 1 ppm 8 hour(s).

NIOSH REL (United States, 6/2008).

TWA: 0.2 mg/m<sup>3</sup> 10 hour(s). TWA: 0.1 ppm 10 hour(s).

OSHA PEL (United States, 11/2006).

TWA: 0.2 mg/m<sup>3</sup> 8 hour(s). TWA: 0.1 ppm 8 hour(s).

OSHA PEL 1989 (United States, 3/1989).

Build 1.1 Page: 1/6

TWA:  $0.2 \text{ mg/m}^3 8 \text{ hour(s)}$ . TWA: 0.1 ppm 8 hour(s).

### Section 4. First aid measures

No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation.

**Eye contact** 

: Check for and remove any contact lenses. Immediately flush eyes with plenty of water for at least 15 minutes, occasionally lifting the upper and lower eyelids. Get medical attention immediately.

Skin contact

: In case of contact, immediately flush skin with plenty of water for at least 15 minutes while removing contaminated clothing and shoes. Wash clothing before reuse. Clean shoes thoroughly before reuse. Get medical attention immediately.

**Frostbite** 

: Try to warm up the frozen tissues and seek medical attention.

Inhalation

: Move exposed person to fresh air. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. Loosen tight clothing such as a collar, tie, belt or waistband. Get medical attention immediately.

Ingestion

: As this product is a gas, refer to the inhalation section.

## Section 5. Fire-fighting measures

Flammability of the product

: Non-flammable.

**Products of combustion** 

: No specific data.

Fire-fighting media and instructions

: Use an extinguishing agent suitable for the surrounding fire.

Apply water from a safe distance to cool container and protect surrounding area. If involved in fire, shut off flow immediately if it can be done without risk.

Contains gas under pressure. In a fire or if heated, a pressure increase will occur and the container may burst or explode.

Special protective equipment for fire-fighters

Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

## Section 6. Accidental release measures

**Personal precautions** 

: Immediately contact emergency personnel. Keep unnecessary personnel away. Use suitable protective equipment (section 8). Shut off gas supply if this can be done safely. Isolate area until gas has dispersed.

**Environmental precautions** 

: Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Methods for cleaning up

Immediately contact emergency personnel. Stop leak if without risk. Note: see section 1 for emergency contact information and section 13 for waste disposal.

## Section 7. Handling and storage

Handling

: High pressure gas. Do not puncture or incinerate container. Use equipment rated for cylinder pressure. Close valve after each use and when empty. Protect cylinders from physical damage; do not drag, roll, slide, or drop. Use a suitable hand truck for cylinder movement.

**Storage** 

: Cylinders should be stored upright, with valve protection cap in place, and firmly secured to prevent falling or being knocked over. Cylinder temperatures should not exceed 52 °C (125 °F).

Build 1.1 Page: 2/6

VISX Laser Mix: Argon / Fluorine / Helium / Neon

## Section 8. Exposure controls/personal protection

**Engineering controls** 

: Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits.

#### Personal protection

**Eves** 

: Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists or dusts.

Skin

: Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.

Respiratory

: Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

The applicable standards are (US) 29 CFR 1910.134 and (Canada) Z94.4-93

**Hands** 

Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary.

Personal protection in case

Self-contained breathing apparatus (SCBA) should be used to avoid inhalation of the product.

of a large spill

**Product name** 

Helium Argon Neon Fluorine Oxygen Depletion [Asphyxiant] Oxygen Depletion [Asphyxiant] Oxygen Depletion [Asphyxiant] ACGIH TLV (United States, 1/2009).

STEL: 3.1 mg/m<sup>3</sup> 15 minute(s). STEL: 2 ppm 15 minute(s). TWA: 1.6 mg/m<sup>3</sup> 8 hour(s). TWA: 1 ppm 8 hour(s).

NIOSH REL (United States, 6/2008).

TWA: 0.2 mg/m3 10 hour(s). TWA: 0.1 ppm 10 hour(s).

OSHA PEL (United States, 11/2006).

TWA: 0.2 mg/m<sup>3</sup> 8 hour(s). TWA: 0.1 ppm 8 hour(s).

OSHA PEL 1989 (United States, 3/1989).

TWA: 0.2 mg/m<sup>3</sup> 8 hour(s). TWA: 0.1 ppm 8 hour(s).

Consult local authorities for acceptable exposure limits.

## Section 9. Physical and chemical properties

**Melting/freezing point** 

: -189.2°C (-308.6°F) This is based on data for the following ingredient: Argon. Weighted average: -236.73°C (-394.1°F)

**Critical temperature** 

: Lowest known value: -267.9°C (-450.2°F) (Helium).

Vapor density

: Highest known value: 1.38 (Air = 1) (Argon). Weighted average: 0.74 (Air = 1)

Gas Density (lb/ft 3)

: Weighted average: 0.03

## Section 10. Stability and reactivity

Stability and reactivity

The product is stable.

**Incompatibility with various** substances

: Incompatible with copper alloys. Slightly reactive to reactive with organic materials

Hazardous decomposition products

: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

**Hazardous polymerization** 

: Under normal conditions of storage and use, hazardous polymerization will not occur.

Build 1.1 Page: 3/6 VISX Laser Mix: Argon / Fluorine / Helium / Neon

## Section 11. Toxicological information

Toxicity data				
Product/ingredient name	Result	Species	Dose	<b>Exposure</b>
Fluorine	LC50 Inhalation Vapor	Rat	1250 mg/m3	5 minutes
	LC50 Inhalation Vapor	Rat	250 mg/m3	60 minutes
	LC50 Inhalation Gas.	Rat	185 ppm	1 hours
	LC50 Inhalation Gas.	Rat	185 ppm	1 hours
	LC50 Inhalation Gas.	Mouse	150 ppm	1 hours

Other toxic effects on

humans

: Hazardous by the following route of exposure: of skin contact (corrosive), of eye contact

(corrosive), of inhalation (lung corrosive).

**Specific effects** 

Carcinogenic effects
 Mo known significant effects or critical hazards.
 Mutagenic effects
 No known significant effects or critical hazards.
 Reproduction toxicity
 No known significant effects or critical hazards.

## Section 12. Ecological information

#### **Aquatic ecotoxicity**

Not available.

**Environmental fate** : Not available.

**Environmental hazards**: No known significant effects or critical hazards.

**Toxicity to the environment**: Not available.

## Section 13. Disposal considerations

Product removed from the cylinder must be disposed of in accordance with appropriate Federal, State, local regulation.Return cylinders with residual product to Airgas, Inc.Do not dispose of locally.

## **Section 14. Transport information**

Regulatory information	UN number	Proper shipping name	Class	Packing group	Label	Additional information
DOT Classification	UN1956	COMPRESSED GAS, N.O.S.	2.2	Not applicable (gas).	TON-TANNAGE CAS	-
TDG Classification	UN1956	COMPRESSED GAS, N.O.S.	2.2	Not applicable (gas).		Explosive Limit and Limited Quantity Index 0.125  Passenger Carrying Road or Rail Index 75
Mexico Classification	UN1956	COMPRESSED GAS, N.O.S.	2.2	Not applicable (gas).	ONLY ANNUAL CASE	-

Build 1.1 Page: 4/6

VISX Laser Mix: Argon / Fluorine / Helium / Neon

"Refer to CFR 49 (or authority having jurisdiction) to determine the information required for shipment of the product."

## Section 15. Regulatory information

#### **United States**

U.S. Federal regulations

: United States inventory (TSCA 8b): All components are listed or exempted.

SARA 302/304/311/312 extremely hazardous substances: No products were found. SARA 302/304 emergency planning and notification: No products were found.

SARA 302/304/311/312 hazardous chemicals: Helium; Argon; Neon

**SARA 311/312 MSDS distribution - chemical inventory - hazard identification**: Helium: Sudden release of pressure; Argon: Sudden release of pressure; Neon: Sudden

release of pressure

Clean Water Act (CWA) 307: No products were found. Clean Water Act (CWA) 311: No products were found.

Clean Air Act (CAA) 112 accidental release prevention: Fluorine

Clean Air Act (CAA) 112 regulated flammable substances: No products were found.

Clean Air Act (CAA) 112 regulated toxic substances: Fluorine

**State regulations**: **Connecticut Carcinogen Reporting:** None of the components are listed.

Connecticut Hazardous Material Survey: None of the components are listed.

Florida substances: None of the components are listed.

Illinois Chemical Safety Act: None of the components are listed.

Illinois Toxic Substances Disclosure to Employee Act: None of the components are

listed.

Louisiana Reporting: None of the components are listed.
Louisiana Spill: None of the components are listed.
Massachusetts Spill: None of the components are listed.

Massachusetts Substances: The following components are listed: HELIUM; ARGON;

**NEON** 

Michigan Critical Material: None of the components are listed.

Minnesota Hazardous Substances: None of the components are listed.

New Jersey Hazardous Substances: The following components are listed: HELIUM;

ARGON: NEON

**New Jersey Spill:** None of the components are listed.

New York Acutely Hazardous Substances: None of the components are listed.

New York Toxic Chemical Release Reporting: None of the components are listed.

Pennsylvania RTK Hazardous Substances: The following components are listed:

HELIUM; ARGON; NEON

Rhode Island Hazardous Substances: None of the components are listed.

**Canada** 

WHMIS (Canada) : Class A: Compressed gas.

**CEPA Toxic substances:** None of the components are listed.

Canadian ARET: None of the components are listed.
Canadian NPRI: None of the components are listed.

Alberta Designated Substances: None of the components are listed. Ontario Designated Substances: None of the components are listed. Quebec Designated Substances: None of the components are listed.

### Section 16. Other information

**United States** 


Label requirements : CONTENTS UNDER PRESSURE.

Canada

Label requirements : Class A: Compressed gas.

Build 1.1 Page: 5/6

Hazardous Material Information System (U.S.A.)

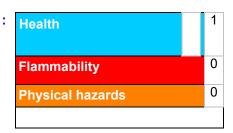

National Fire Protection Association (U.S.A.)



#### **Notice to reader**

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.

Page: 6/6